


ADDENDUM TO: VISTA-100 INSTALLATION INSTRUCTIONS

USE WITH ISSUE: N6019-2

The 5881EH wireless receiver and 5808 smoke detector are now listed for use in commercial fire applications. These features are pending CSFM approval. The following provisions apply:

1. Program fields 1*30 and 1*31 currently state that the supervision period for the wireless receiver and transmitters must be no longer than 6 hours. This should be no longer than 4 hours (program entry of "2") for commercial fire applications.
2. On page 141 of the Vista-100 Installation Instructions, zones 989 and 991 are stated to be the supervisory zones for receivers 1 and 2. Actually, each receiver's supervisory zone is equal to 8 + the two-digit device address of the receiver. For example, if the receiver is set to device address 05, the receiver's supervisory zone would be 805. The supervisory zone must be programmed for 24-hour trouble (zone type 19).
3. Zones 990 and 988 are used to supervise the RF reception of receivers 1 and 2, respectively. These zones must be programmed for a response type of 24-hr. Trouble (zone type 19). A fault on either of these zones indicates that:
 - A. the receiver has detected a condition that may impede proper RF reception (i.e., jamming or other RF interference)
 - OR
 - B. the receiver has not received any RF messages in the time period defined by program field 1*30. In this case, the fault would be accompanied by a supervision fault for one or more RF transmitters as well.
4. DIP Switch #5 on the 5881EH receiver must be set to "ON" for commercial fire applications (see figure below).
5. The 5881EH receiver must be mounted in a metal enclosure for commercial fire applications. When mounting in the enclosure, DO NOT use the antenna grounding lugs. Additionally, you must use an insulating washer (supplied) between the head of each screw and the PC board (see figure below).

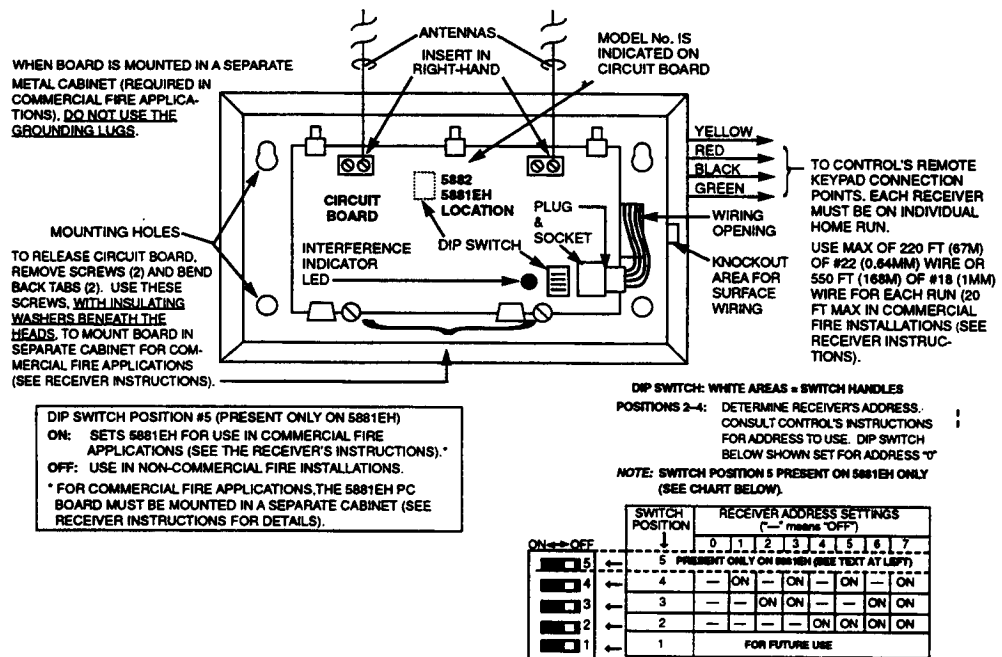

Important Note regarding Duress:

To enable the Duress feature, make sure you complete the following steps:

1. Enable Duress for each partition in program field *85.
2. Enter a report code for zone 992 (the feature will not work if a report code is not programmed).