

(619) 438-7000 - FAX (619) 438-7043 USA & Canada (800) 421-1587 & (800) 392-0123 Toll Free FAX (800) 468-1340

CP-90 PROGRAMMING INSTRUCTIONS ADDENDUM #212331

The following items are for the correction and upgrading of the CP-90 Programming Instructions (Linear P/N: 208254 B).

Page 14:

CORRECTION: Changing Values, change Figure 19 to Figure 20 in paragraph three, disregard "NOTE"

Page 22:

MISSING - ADD: Figure 36, An event between step #2 and #3 "Enter Unused Sensor Number"

Page 27:

CHANGE: Figure 40., "General Communicator Operation Chart", Function 50 Selector 2 and 3 value "1-12" to read "1-13", and ADD: to "Communicator Format Table" Value = 13, Format = ADEMCO Contact ID, (NOT TESTED FOR UL INSTALLATIONS), and Format Specifications = Proprietary

Page 32 - 33:

ADD: Paragraph 063.00, 066.000, AND 069.000, "With the exception of leading zeros" after the sentence "All digits of the account number must be entered."

Page 35:

DELETE: Figure 45, Function 70 - 75, Selector 29, "Battery Fuse Blown"

Page 37:

DELETE: Function 70 - 75, Selector 29, "Battery Fuse Blown"

Pages 38 and 39:

REPLACE: If using Ademco Contact ID format, call Technical Service 1 (800) 421-1587 for replacement pages.

Page 40:

ADD: Function 91, "When canceling a PAC, all characteristics of that PAC will be canceled as well."

Page 41:

ADD: to Step 1, "... and then press #" under section "Changing Temporary PAC Outside of Level 9

Page 43:

ADD: Figure 50, Function 121, Selector 6, Should be "Keypad Burglary for Lock-ins", 0=Normal; 1 = Any key starts entry delay #1 while in Level 4.



(619) 438-7000 - FAX (619) 438-7043 USA & Canada (800) 421-1587 & (800) 392-0123 Toll Free FAX (800) 468-1340

CP-90 PROGRAMMING INSTRUCTIONS ADDENDUM # 212331

Page 44:

ADD: 121.006 Causes an entry delay #1 (Function 120.001) to start when any keypad key is pressed if the system is armed in Level 4 (away mode). This feature is useful in installations where someone might try to compromise the system by staying inside the secured premises. The default Value of 0 disables this feature. Enter a Value of 1 if keypad burglary for lock-in is required.

Page 44:

ADD: 121.016.000 to Note, "...as an Interior Burg/Intrusion."

The following items are for the correction and upgrading of the CP-90 Programming Instructions (Linear P/N: 208254 C).

Page 14:

CORRECTION: "Changing Values", disregard "NOTE"

Page 22:

MISSING - ADD: Figure 36, an event between step #2 and #3, "Enter Unused Sensor Number"

Page 32 - 33:

ADD: Paragraph 063.00, 066.000, AND 069.000, "With the exception of leading zeros" after the sentence, "All digits of the account number must be entered."

Page 43:

ADD: to Step 1, "... and then press #" under section "Changing Temporary PAC Outside of Level 9

Page 45

ADD: Figure 53, Function 120.001, insert "#1" between the words delay and while.

Page 46

CHANGE: Paragraph 121.006.00 first sentence to read, "Causes entry delay #1 to start..."

Page 47:

ADD: 121.016.000, to Note, "...as an Interior Burg/Intrusion."