

# TECHNICAL BULLETIN

## Intrusion

ITI Wireless Transmitters

### Low Battery Issue

February 15, 2007

#### Issue Severity:



**High:** Act immediately



**Medium:** Bosch Security Systems, Inc.  
strongly recommends you take the action(s)  
described below.




**Low:** Advisory

#### Products Affected:

- ITI Wireless Transmitters
- 2000 Series Control Panels
- 6000 Series Control Panels

### 1.0 Issue

ITI transmitters purchased between February 2004 and June 2005 might send low battery signals to the control panel prematurely. Replacing the batteries fixes the problem for 60 days or less. Only ITI transmitters with a gray super capacitor on the printed circuit board might exhibit this behavior.

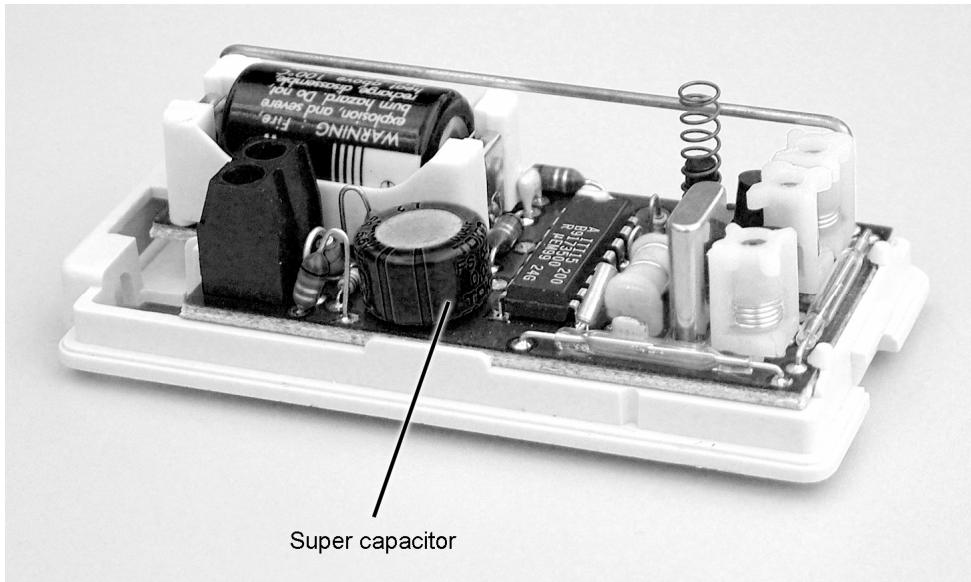

### 2.0 Resolution

Replace all ITI wireless transmitters that exhibit this behavior. For information on what model transmitters are affected, and how to receive a replacement transmitter, refer to the GE Security *Wireless Devices with Gray "Super-Capacitor" Customer Note*, dated November 16, 2006. You can download this document from the GE Security web site at: <http://www.gesecurity.com/GESecurity/images/DWS%20customer%20notice.pdf>.

You can also e-mail Mike Shere at [michael.shere@ge.com](mailto:michael.shere@ge.com).



**BOSCH**

